




WAAS CH 70309 W04A	APP CRS 043°	Rwy Idg TDZE Apt Elev	7927 592 598
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 4

ABRAHAM LINCOLN CAPITAL (SPI)

	DME/DME RNP-0.3 NA. For uncompensated Baro-VNAV systems LNAV/VNAV NA below -16°C (4°F) and above 47°C (116°F). When local altimeter setting not received, use Lincoln altimeter setting and increase all DA 57 feet, all MDA 60 feet, and Circling Cat C visibility ¼ mile. Baro-VNAV and VDP NA when using Lincoln altimeter setting. For inoperative MALSRL increase LPV all Cats visibility to RVR 5000.	MALSRL 	MISSED APPROACH: Climb to 2600 direct REYCO and hold.

ATIS 127.65 270.1	SPRINGFIELD APP CON * 126.15 323.0	SPRINGFIELD TOWER * 121.3 (CTAF) 257.8	GND CON 121.9 348.6	CLNC DEL 121.7	UNICOM 122.95
-----------------------------	--	--	-------------------------------	--------------------------	-------------------------

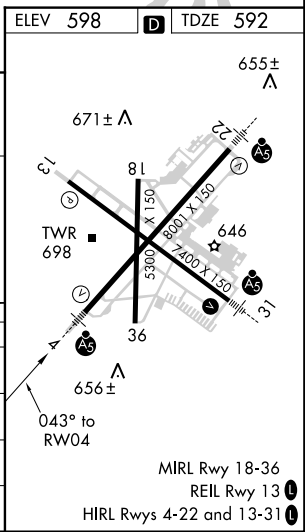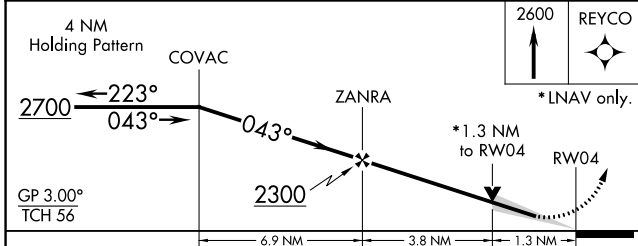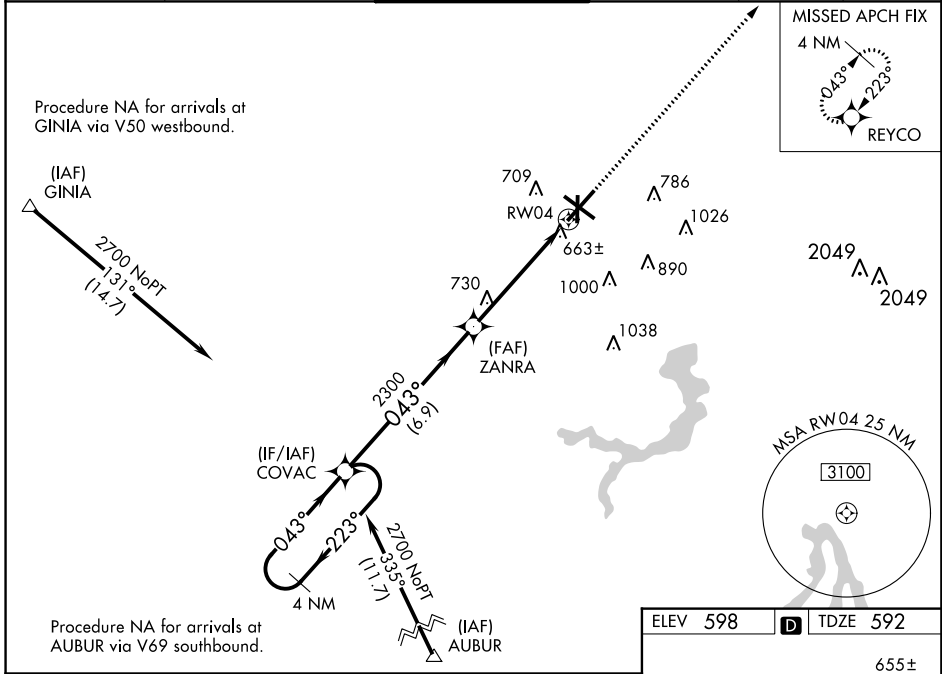

CATEGORY	A	B	C	D
LPV DA		854/24	262 (300-½)	
LNAV/VNAV DA		931/40	339 (400-¾)	
LNAV MDA	1060/24	468 (500-½)	1060/50	468 (500-1)
CIRCLING	1160-1	562 (600-1)	1160-1½ 562 (600-1½)	1200-2 602 (700-2)

EC-3, 09 NOV 2017 to 07 DEC 2017

EC-3, 09 NOV 2017 to 07 DEC 2017