

APP CRS <b>313°</b>	Rwy Idg <b>4500</b>
	TDZE <b>429</b>
	Apt Elev <b>429</b>



# RNAV (GPS) RWY 31

MOUNT CARMEL MUNI (AJG)


**NA** DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. When local altimeter setting not received, use Lawrenceville altimeter setting and increase all MDA 40 feet and increase LNAV Cat. D visibility ¼ mile.

**MISSED APPROACH:** Climbing left to turn 2500 direct NIYRI and hold.

AWOS-3 <b>134.9</b>	EVANSVILLE APP CON★ <b>125.6 343.7</b>	UNICOM <b>122.7 (CTAF) 0</b>
------------------------	---	---------------------------------

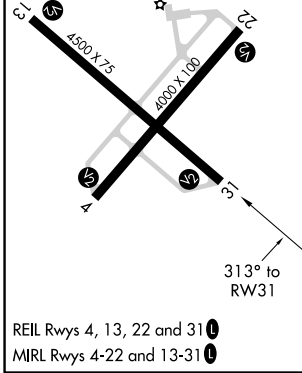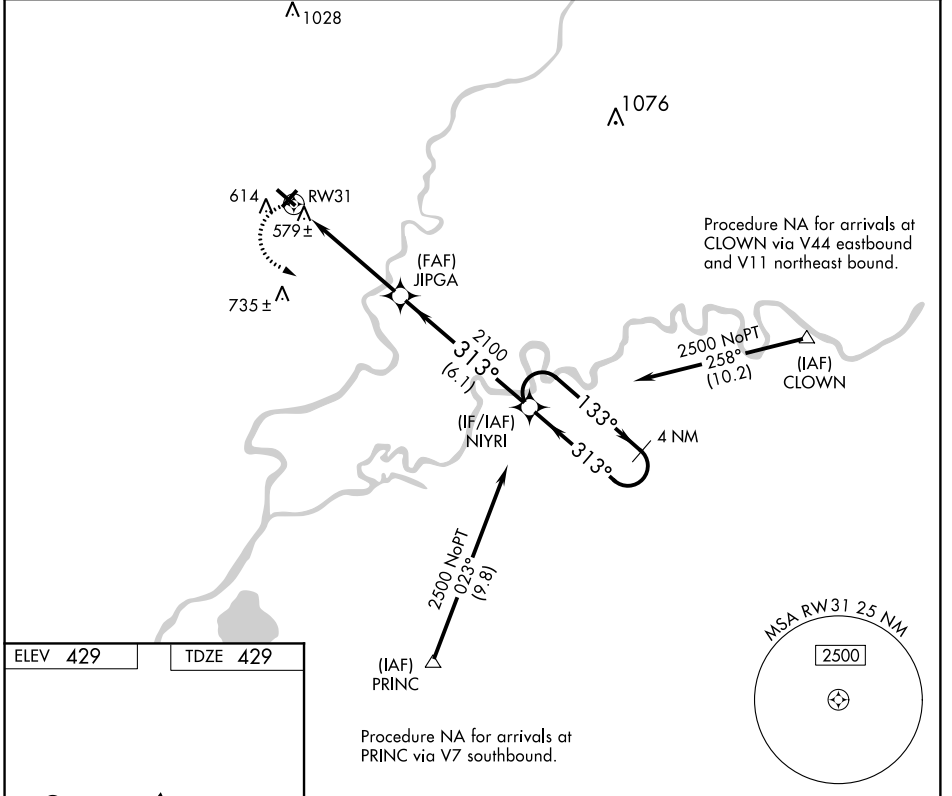

2500 NIYRI VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25). 4 NM Holding Pattern

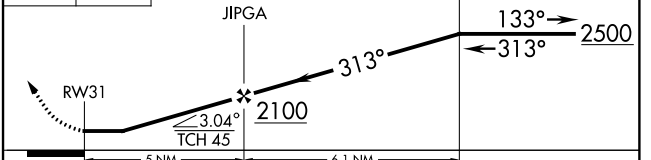

CATEGORY	A	B	C	D
LNAV MDA	840-1	411 (500-1)	840-1¼	411 (500-1¼)
CIRCLING	980-1	551 (600-1)	980-1½	980-2 551 (600-1½)

EC-3, 04 JAN 2018 to 01 FEB 2018

EC-3, 04 JAN 2018 to 01 FEB 2018