

APP CRS 313°	Rwy Idg 4500
	TDZE 429
	Apt Elev 429



RNAV (GPS) RWY 31

MOUNT CARMEL MUNI (AJG)

NA DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. When local altimeter setting not received, use Lawrenceville altimeter setting and increase all MDA 40 feet and increase LNAV Cat. D visibility ¼ mile.

MISSED APPROACH: Climbing left to turn 2500 direct NIYRI and hold.

AWOS-3 134.9	EVANSVILLE APP CON★ 125.6 343.7	UNICOM 122.7 (CTAF) 0
------------------------	---	---------------------------------

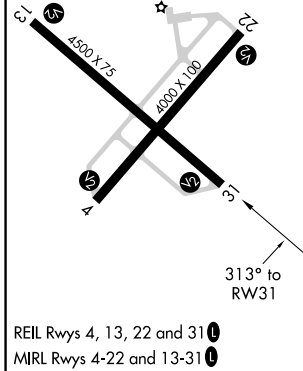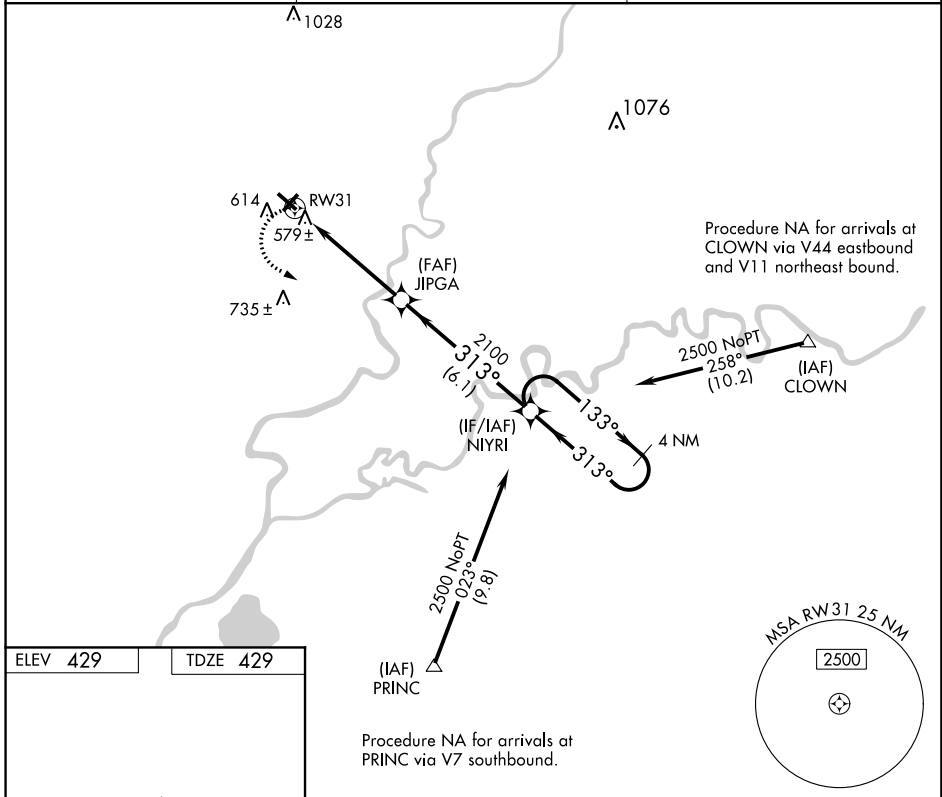

2500	NIYRI	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).	4 NM
		NIYRI Holding Pattern	
		JIPGA	NIYRI
RW31		2100	2500
5 NM		6.1 NM	
CATEGORY	A	B	C
LNAV MDA	840-1	411 (500-1)	840-1¼ 411 (500-1¼)
CIRCLING	980-1	551 (600-1)	980-1½ 980-2 551 (600-1½) 551 (600-2)

EC-3, 01 MAR 2018 to 29 MAR 2018

EC-3, 01 MAR 2018 to 29 MAR 2018